


POWER HITESTER 3193-10

Power Measuring Instruments

Wide Spectrum Power Meter for **Comprehensive Device Assessment**

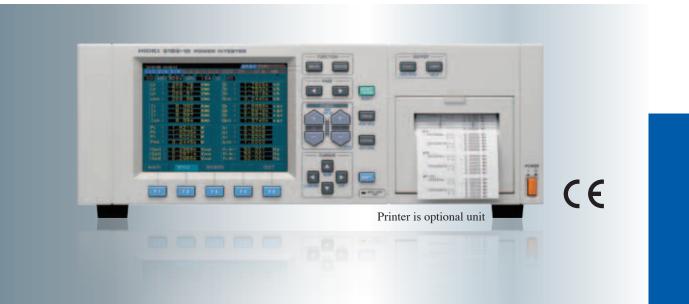

DC/0.5Hz to 1MHz broad-band POWER HITESTER measures up to 6 systems simultaneously.

The POWER HITESTER 3193-10 is a multi-function power meter for use with single phase power lines to 3-phase, 4-wire circuits. Accommodating up to 6 units, it is not only capable of measuring up to 6 single phase systems, but can simultaneously measure the input and output of a 3-phase inverter and provide effective power measurements. Additionally, it supports harmonic analysis and flicker measurement (optional), features which are essential for overall device assessment. Standard features include a GP-IB and RS-232C interface, making it easy to feed data to a personal computer for processing and analysis. This unit is ideal for those requiring greater efficiency in electrical device assessment.





JQA-E-90091 JMI-0216



AC/DC CURRENT SENSOR

Rated at 1000A rms Wide bandwidth Super high precision

Complete with functions that answer all your power measurement needs.



Features

Wide range of measurement functions

Capable of measuring voltage, current, active /reactive /apparent power, power factor, phase, frequency, and current, and of integrating power according to polarity, the **3193-10** also provides wave peak and efficiency measurements that are essential to device assessment.

Measure Motor Output

With the optional EXTERNAL SIGNAL INPUT UNIT 9603, the HITESTER can take analog input in from torque and revolution measurements and use that information to calculate motor output.

Measurement for Minute Stand-by Power also Available

(by special-order) The 9600 and 9601 input units have 10-times improved current sensitivity, and currents starting from the 20.000mA range can be measured. (Please inquire for further information.)

High Visibility Color LCD

Featuring a wide viewing angle, the color LCD displays a variety of items simultaneously, making it ideal for quickly grasping power usage on the system being measured. Expanded display is possible for any four selected items.



Harmonic and Flicker Analysis

Harmonic and flicker analysis are possible when using the optional HARMONIC / FLICKER MEASUREMENTS UNIT 9605.

■ High Basic Accuracy of ±0.2%

Measurements of even greater precision can be obtained using the optional **9600** to **9602** input unit, which provides a basic accuracy of $\pm 0.1\%$ rdg, $\pm 0.1\%$ f.s. (With the 9602, the accuracy of the clamp-on sensor is a factor affecting total accuracy during power measurement.)

A Variety of Interfaces for Differing Needs ★ Connecting to a PC

The RS-232C and GP-IB interface, provided as standard features, make it possible to connect the power meter directly to a PC, allowing efficient measurement, management and analysis of data.

\bigstar Connecting to a Recorder

With 8 selectable D/A outputs and voltage, current and power analog/monitor output (current and voltage only) as standard features, the **HiTESTER** allows recording of changes and transient fluctuations in waveforms using a recording unit.



★ Connecting to a Printer

Data can be output to the optional **PRINTER UNIT 9604**.

Print type Paper width Main functions

: Thermal line dot printing : 72mm

: printing of items measured, hard copy output of displayed screens, printout of meter settings, printout of various times (such as interval time, timer time, and realtime control time). Printouts are performed either automatically, upon input of an external control signal, or synchronized with an integrator.

DC/0.5Hz to 1MHz broad-band POWER HiTESTER measures up to 6 systems simultaneously.



1ch

2ch

Choose from a variety of input units according to application

Three types of input units are available, including the **9602** AC/DC Clamp Input Unit, which can be used with current levels exceeding 50A under live circuit conditions, as well as the **9600** and **9601** which accept direct input of up to 1000V/50A.

- 9600 · · · DC/0.5Hz to 1MHz wide band
- 9601 $\cdot \cdot \cdot 5$ Hz to 100kHz, for AC only
- 9602 · · · DC/0.5Hz to 200kHz clamp input


Choose from a variety sensors including AC Clamp On Sensors 9272-10 and 9290-10, AC/DC Clamp On Sensors 9277, 9278 and 9279, and super high-precision AC/DC Sensors CT6865, 9709, CT6862 and CT6863.

Feed-through current sensors







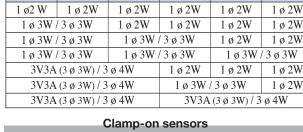

4ch

5ch


6ch


3ch




Simultaneous Measurement of Multiple Systems


Since all units are mutually isolated, the primary and secondary sides of devices or disparate power lines can be measured simultaneously. Simultaneous measurement of single phase 6 wire or 3 phase 2 wire systems which previously required multiple units, can now be handled with one. What's more, measurements of all devices can be taken at the same instant, providing a powerful tool for integrated, all-round device assessment.

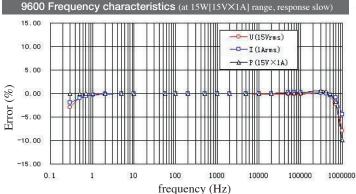

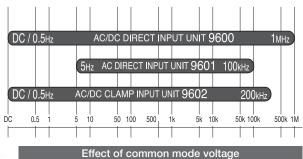

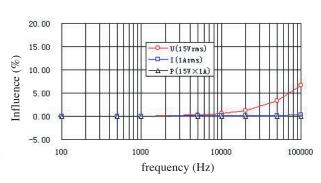

The Power Analysis Station

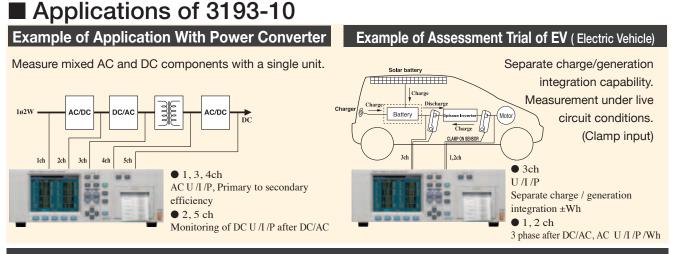

Even Supports Harmonic / Flicker analysis when using the optional 9605 HARMONIC / FLICKER MEASUREMENTS UNIT .

Graph Display of Harmonics

Voltage, current and power can be analyzed and displayed by bargraphs of harmonic amplitude, content and phase angle.Voltage, current and power can be displayed simultaneously for a single channel, or a single parameter can be displayed simultaneously for each of three channels.



List Display of Harmonics

The harmonic list display shows the amplitude, pro-portion, phase angle and distortion for each harmonic of voltage, current and power. Displaying only proportion, or two parameters simultaneously, such as amplitude and phase angle, is selectable.

*12 ABURE COLUMN CO		MEAS POLE
1+h 2+h 3+h 200	NUT ON A DOM NOT ON A DOM NOT	STORE STREET, STORE STREET, STORE
THE BUILDOOV BU	ALMAN A	· · · · · · · · · · · · · · · · · · ·
		a language
STEPS WITH WHER	THDR: 004035x	fer: 50:01Hz
AT BEEN INCO	THDF: 0.94%	U1100240038V
In COLUMN TWO IS NOT	the summer water	NAME OF COLORADORS OF COLORADORS
D 76.18 1 8.49	18: 0.05 p-195.21	70: 4.25 1 14.45
21 1,11 1 20,00	81 8.82 + 187,28	384 0.18 c 100.64
31 1.14 1111.41	E81 8.84 H- 15.85	171 - 41.04 1 - 40.40
41 BARLIN BALLE	TR: 0.05 - 01;40	38+ 1,84 L 82,85
50 R.88 1 72-34	EE1 8.85 1 383-34	381 0.62.1+112.51
87 8.88 1 132,43	E21 0.85 1+141.73	abr 0.07 t= 54.61
1 0.12 + 10.11	Ent 0.02 ++204-05	410 8168 4 49181
81 8.15.1.161.82	25c 8.68 c=107.68	421 8.19 to 95,94
B 8.55 (7 - 3.94	TRA 0.03 1 02,17	40. 8.30 1 26.65
18: 0.25 (+180.17)	844 8,38.4-51,80	### #.25.1.119.88
8,82 38,96	EB1 0.09.1-159,41	45c 91.36 1+153/38
ED 8083 1 8044	201 0.12 1.012	### #175 (~174.82
LB:	8.09 58.48	#To
14: 0.00 ce181,42	81 - 8.88 × 325.98	481 1418 (** 88.68
13/ 8.89.1+.82.89	804	484
8.92 11154.91	801 0.49 1.981.30	28+ 0.64 + 155.00


Flicker Measurement Display

Displays data during measurement in real-time. Display can also be switched to D measurement and "Pst" value.



Waveform Display

The waveform display shows one cycle of the voltage and current waveforms. RMS and peak values can be displayed along with voltage and current waveforms, or voltage and current waveforms for up to three channels can be displayed at the same time.

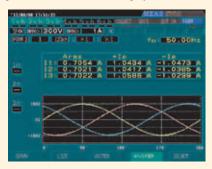

Vector Display of Harmonics

The harmonic vector display shows the voltage, current and phase angle for each harmonic, making clear the voltage-current phase relationship.



Monitor Display

The relative "d" voltage change $\Delta V/V$ and the instantaneous flicker value "S(t)" can be displayed in a time series, so past variations are clearly displayed.



9605 Specifications (optional)

Installation	: Installs in the 3193-10 main unit
Measurement lines	: Single-phase 2- and 3-wire, three-phase 4-wire
No. of channels	: Up to 3 channels within channels 1 to 6, depending
	on 3193-10 wiring mode
Output functions	: RS-232C, GP-IB, printer
Harmonic V	Vaveform Analysis Functions

Measurement range :	Fundamental frequency: 1 to 440 Hz
	PLL system (5 to 440 Hz), external clock system (1 to 5 Hz)
Orders analyzed :	Up to 50th harmonic (with 1 to 250 Hz fundamental)
Window width	16 cycles (for 40 to 70 Hz fundamental)
Windowing type :	Rectangular tiling (no gap between or overlap of windows)
Amount of data analyzed :	512 points (for 40 to 70 Hz fundamental)
Crest factor	Up to 4 (current), and up to 3 (voltage)
Measurement items :	Harmonic level, percentage and phase angle of each order
(of harmonic wave for each of voltage, current and power.
· · · · · · · · · · · · · · · · · · ·	Total up to 50th harmonic (of 40 to 70 Hz fundamental) for

voltage, current and power. Total harmonic distortion for voltage and current (THD-F and THD-R)

Measurement of voltage, current, active power, peak voltage and peak current values of the fundamental

: Every 1 window (except during communications with other devices) Update rate Screen displays : List, graph, vector and waveform Harmonic levels; at 45 to 66 Hz Accuracy* Voltage/current: ±0.5%rdg.±0.05% f.s. Active power: ±1.0%rdg.±0.1% f.s. For 45 to 66-Hz fundamental, effective input is 0.1 to 110% of range

Flicker Measurement Function

Measurement range : Fundamental frequency; 45 to 66 Hz, PLL synchronization system Analysis items : dc (relative constant voltage change), d max (max. relative constant voltage change), d(t)500ms (relative voltage change per time), P0.1/ P1s/ P3s/ P10s and 30s (cumulative probability), Pst (short-term flicker value), Plt (long-term flicker value)

Screen displays : Measured value, CPF, Pst list, Monitor


Accuracy* : RMS voltage ±0.5%rdg.±0.05%f.s. (45Hz~66Hz)

* The reading accuracy of the input unit must combined with the analysis accuracy shown above. When used with a clamp sensor, accuracy and frequency characteristics of the clamp must be added to the analysis accuracy above.

Other Analysis Functions


Integration According to Polarity

Positive, negative, and total current and power can be integrated simultaneously for all channels. This makes it possible to grasp the income and outflow of power at a glance.



Analog and D/A Output

Analog (voltage, current, and effective power) and D/ A outputs (any selected eight items) are output as a 5V range full scale value. (Except for the 1000V range), 100ms response time can be obtained by using the FAST setting.

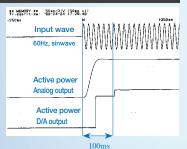

3 Types of Averaging Functions

Select from time average, moving average and exponential average.

Sch Frequency Measurement Function

With the frequency ranges, LPF and HPF can be used in combination, allowing measurement of fundamental waveforms and carrier waveforms of inverters.

Efficiency Calculation Function

Three efficiency calculations can be obtained simultaneously from measured voltage values.

Multi-Channel Recorders


MEMORY HICORDER MR8847-01/02/03


The Ideal Recorder for Field Use, Easy Portability and Sturdy Construction

- 20M-Sampling/s
- Max. 16 ch + logic 16 ch
- 32M to 256M-Word Memory (2ch)

Peak Measurements Function

Voltage and current wave peaks can be measured. The Peak Hold function can be used to find peak values and effective maximums for motor rush current waves.



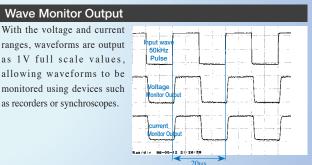

3 Types of Built-in Low Pass Filters

Selectable cutoff frequencies (500/5k/300kHz) allow extraction of the frequency component of fundamental inverter waveforms and provide data compatibility with previous instruments.

• Choose from Three Types of Calculation Algorithms

Three selectable algorithms are provided for calculating apparent power and reactive power, providing compatibility with previous devices

MEMORY HICORDER MR8875



Smart Design - Smart Engineering

- 500k-Sampling/s
- Max. 16ch+Logic 8ch
- Memory 8M-word by each input unit, total 32M-words

.

Optional Input Unit Specifications

Customized versions of Models 9600 and 9601 are also available for stand-by power

		measuremen	nt with 10-ti	mes improved sensitivity	for current ranges. Please	e ask for detailed specs.		
	AC/DC DI	RECT I		UNIT 96	600	AC/DC CLAMP INPUT UNIT 9602		
	Voltage	Cur	rent	Active	power	Voltage	Current	Active power
Measurement	6.0000/15.000/30.000/	200.00/50	00.00mA/	Deper	nds on	6.0000/15.000/30.000/	500.00mA to 1000.0A	Depends on
	60.000/150.00/300.00/	1.0000/2.00		combination	0	60.000/150.00/300.00/	(Depends on clamp-on	combination of voltage
range	600.00V/1.0000 kV	10.000/20.00	00/50.000 A	and curre	nt ranges	600.00V	sensor)	and current ranges
Max.operating input(55Hz)	1000Vrms/1500 V peak	65Arms/1	1			650Vrms/850Vpeak	(Depends on clamp-on sensor)	
Crest factor	Lower of either (measured or maximum permissible r	range X 6) / m ated peak / mea	easured value isured value			Lower of either (measured ra maximum permissible ra	ange \times 6)/ measured value or ted peak/measured value	
Input resistance	2MΩ±5%	1mΩ	max.			2MΩ±5%	200kΩ±5%	
Accuracy	(Accuracy assured at 23	F ±9°F) at 804	% R.H., pow	er factor = 1	, sine wave input, in-phas	e voltage 0, after DMAG	;)	
DC	±0.1%rdg.±0.2%f.s.	÷	_	~	-	±0.1%rdg.±0.2%f.s.	←	←
0.5 to 1Hz	$\pm 0.5\%$ rdg. $\pm 0.5\%$ f.s.	÷	←		-	±0.5%rdg.±0.5%f.s.	←	←
1 to 10Hz	$\pm 0.2\%$ rdg. $\pm 0.2\%$ f.s.	÷	←		_	±0.2%rdg.±0.2%f.s.	←	←
10 to 45Hz	±0.1%rdg.±0.2%f.s.	÷	←		_	±0.1%rdg.±0.2%f.s.	←	←
45 to 66Hz	$\pm 0.1\%$ rdg. $\pm 0.1\%$ f.s.	÷	←		_	±0.1%rdg.±0.1%f.s.	←	←
66Hz to 10kHz	$\pm 0.1\%$ rdg. $\pm 0.2\%$ f.s.	÷	_	~	_	±0.1%rdg.±0.2%f.s.	←	←
10 k to 50kHz	$\pm 0.3\%$ rdg. $\pm 0.3\%$ f.s.	÷	_	~	-	±0.5%rdg.±0.5%f.s.	←	←
		Less than 5 A	Greater than $5 \ A$	Less than 5 A	Greater than 5 A			
50 k to 100kHz	±0.5%rdg.±0.5%f.s.	±0.5%rdg. ±0.5%f.s.	±2.5%f.s.	±0.5%rdg. ±0.5%f.s.	±5.0%f.s.	±0.5%rdg.±0.5%f.s.	←	±0.3%rdg.±0.5%f.s.
100k to 300kHz	±0.5%rdg.±0.5%f.s.	±0.5%rdg. ±0.5%f.s.	±5%f.s.	$^{\pm 1.0\%}$ rdg. $^{\pm 1.5\%}$ f.s.	±10.0%f.s.	$\pm 15\% f.s.$ (up to 200kHz)	←	$\pm 30\% f.s.$ (up to 200kHz)
300k to 400kHz	±1.5%rdg.±0.5%f.s.	±1.0%rdg. ±0.5%f.s.		$\pm 1.0\%$ rdg. $\pm 2.5\%$ f.s.		Compatible Clamp (Optional)	9279	CT6862 CT6863
400k to 500kHz	±2.0%rdg.±1.0%f.s.	±2.0%rdg. ±1.0%f.s.		$\pm 2.0\%$ rdg. $\pm 2.5\%$ f.s.		9272-10		865/9709
500k to 700kHz	±10.0%f.s.	±10.0%f.s.		±15.0%f.s.		With the 9602 , the accuracy of the clamp-on sensor is a fa total accuracy during current measurement, as are phase a		
700k to 1 MHz	±15.0%f.s.	±15.0%f.s.		±30.0%f.s.		characteristics. See page 8	for details on the clamp-on	sensor specifications.

	AC DIRI	ECT INPUT UI	NIT 9601	Assured Accuracy Range for Input Frequency of the 9600
	Voltage	Current	Active power	9601 and 9602 each have assured ranges for input frequency.
Measurement	60.000/150.00/300.00/6	200.00/500.00mA/ 1.0000/2.0000/5.0000/	Depends on combination of voltage	
range	00.00V/1.0000 kV	10.000/20.000/50.000 A	and current ranges	별 700V
Max.operating input(55Hz)	1000Vrms/1500 V peak	65Arms/100 A peak		500V
Crest factor	Lower of either (measured or maximum permissible r	range X 6) / measured value ated peak / measured value		400V 300V 220V
Input resistance	2MΩ±5%	$1m\Omega$ max.		2007
Accuracy (Accuracy	assured at 23°C ±5°C(73°F ±9°F)	at 80% R.H., power factor = 1, sine	e wave input, in-phase voltage 0)	0 0 0.5 1 10 ⁴⁴⁰⁹ 100 1k 10k 100k 1MH
5 to 10Hz	±2.5%f.s.	←	←	70A [
10 to 20Hz	±1.0%f.s.	←	←	60A
20 to 45Hz	±0.1%rdg.±0.2%f.s.	←	←	50A 50A
45 to 66Hz	±0.1%rdg.±0.1%f.s.	←	←	40A
66Hz to 5kHz	±0.1%rdg.±0.2%f.s.	←	←	
5k to 10kHz	±0.2%rdg.±0.4%f.s.	←	←	204 204 204
10k to 20kHz	±1.0%f.s.	←	←	104
20k to 50kHz	±2.5%f.s.	←	←	
50k to 100kHz	±10.0%f.s.	←	←	DC 0.5 1 10 100 1k 10k 50k 100k 1MH Frequency (Hz)

Note 1: Assured accuracy ranges for different response settings are as follows: FAST (0.1 sec) to DC and greater than 50 Hz, MID (0.8 sec) to DC and greater than 10 Hz, SLOW (5.0 sec) to DC or greater than 0.5 Hz Note 2: Assured accuracy ranges for combined mode measurement are 10 Hz or greater for the AC mode, and DC only for the AC+DC mode or DC mode.

Calculation algorithm (Indicated only for single phase, 2 wire and 3 phase, 3 wire (3V3A). Two additional calculation algorithms can be selected for apparent/reactive power)

		Voltage	Current	Active power	Apparent power	Reactive power	Power factor	Phase
	1ø2W	\mathbf{U}_1	I_1	\mathbf{P}_1	$S_1=U_1 \times I_1$	$Q_1 = s_1 \sqrt{(U_1 I_1)^2 - P_1^2}$	$\lambda_1 = s_1 P_1/S_1 $	$\phi_1 = s_1 \cos^{-1} \lambda_1 $
S U M	3ø3W (3V3A)	$U_{1\cdot 2\cdot 3} = \frac{U_1 + U_2 + U_3}{3}$	$I_{1\cdot 2\cdot 3} = \frac{I_1 + I_2 + I_3}{3}$	$P_{1\cdot 2\cdot 3}=P_1+P_2$	$S_{1+2+3} = \frac{\sqrt{3}}{3}(U_1I_1 + U_2I_2 + U_3I_3)$	$Q_{1:2:1} = \frac{1}{s_1 \sqrt{(U_1 I_1)^2 - P_1^2} + s_2 \sqrt{(U_2 I_2)^2 - P_2^2}}$	$\lambda_{1\cdot 2\cdot 3} = su \left \frac{P_{1\cdot 2\cdot 3}}{S_{1\cdot 2\cdot 3}} \right $	$\phi_{1:2:3} = su \cos^{-1} \lambda_{1:2:3} $

Note 1: The above calculation algorithm is for a single phase, 2 wire input to ch 1, and 3 phase, 3 wire input to ch 1/2/3 (3 voltage, 3 current).

Note 2: The "s" before each power factor or phase operation indicates the lead or lag of current phase in relation to voltage. The "-" sign means current phase leads voltage and when there is no symbol, it lags. "su" is "-" when the sum of reactive power is negative and "+" (but unsigned) when it is positive.

Basic specifications _

Measurement line	: Single phase 2 wire, single phase 3 wire, 3 phase 3 wire (3V3A is possible), 3 phase 4 wire
Measurement item	: When using 9600 , 9601 , 9602 (optional)
	Voltage, current, voltage/current peak, effective/reactive/apparent power, power factor, phase, frequency, current/power integration, load rate, efficiency.
	When using the 9603 (optional)
	Voltage, torque, r/min, frequency, motor output.
	When using the 9605 (optional)
Display indication range	Harmonic, waveform, voltage fluctuation / flicker measurement function. : At the lowest range in the DC mode of Models 9600 & 9602 : 0.2% to 130% At the lowest range of Model of Models 9600 & 9602 : 0.5% to 130% At the 200mA range of Model 9601 : 0.5% to 130% At 0.1% to 130% of all other ranges. All range is zero suppressed at less than lower % value.
	Valid input range for voltage, current, and power is 0.5% to 110%
Display	: 6.4 inch TFT color LCD (640 × 480 dot)
Display resolution Rectification method	
Display update rate	
Combined mode	: DC, AC + DC, AC (AC only when used in combination
	with 9601 or 9602 + AC clamp-on sensor)
Analog response time	: FAST (0.1 sec.), MID (0.8 sec.), SLOW (5.0 sec.) (Time required for stabilization to within ±1% when input is changed from 0% to 90%, or 100% to 10% of range.)
Low pass filter	: OFF / 500Hz / 5kHz / 300kHz (-3dB) For 9601, 5k
	/ 300kHz not available.
Polarity detection regulation filter	: OFF / 200Hz (-3dB)
Analog output	: Voltage / current / active power DC ±5V f.s (1000V range is DC ±3.333 V f.s.)
Monitor output	: Voltage / current: 1Vrms f.s. (1000V range is 0.6667 Vrms f.s.)
	rent/ Active power measurement]
	· ·
Measurement range	: See Page 5 specifications for individual input units
[Integration n	neasurement]
Number of measurements	: 64 times/sec
	: 0 to±9999999 TAh / TWh (integration time up to 10,000 hours)
[Power factor	/ Phase angle measurement]
Measurement range	: -1.0000 (lead) to 0.0000 to 1.0000 (lag) -180°(lead) to 0.00°to 180.00°(lag)
	-

[Frequency measurement]

Number of channels	:	$Max. \ 3ch \ (selection \ of \ voltage \ or \ current \ for \ arbitrary \ channel)$
Effective input range	:	0.5 Hz to 2 MHz
Measurement range	:	Auto / 50Hz/ 500Hz / 50 kHz / 2 MHz

[Wave peak measurement]

[Wave peak I	measurement]
Measurement items	: Select either voltage or current for each unit (Shows absolute value of max.)
Effective Input Range	: Effective value of sine wave is within effective input permissible in the range
[Motor output (Pm) measured] 9603 (optional) external input unit required
Measurement method	: Digital calculation from measured voltage or pulse signal Effective when 9603 ch A is torque (any of N/ m, mN/m, kN/m, kgf/m, kgf/cm), and ch B is r/m
Display indication range	: 0.1% to 130% of 9603 voltage range (polarity not indicated)
Calculation algorithm	: Set to required format
[Efficiency mea	surement]
Calculable factors	: Maximum of 3 formats
Calculated items	: P for each input unit, Pm when combined with 9603 (Items measured with 9605 not allowed)
[D/A output]	
Number of channels	: 8ch (12 bit D/A converter polarity + 11bit)
Output impedance	: 100Ω±5%
Output items	: Outputs 8 arbitrarily selected items
Output voltage	: $DC\pm5V/f.s.$
Output update rate	: 16 times/sec
[Interface]	
GP-IB	: Conforms to IEEE-488.1 1987, with reference to IEEE-488.2 1987
RS-232C	: Start-stop synchronous, with baud rate of 2400 or 9600 bits/sec
[External Co	ntroll
Functions	: Integration start / stop control, Integration data reset, External A/D (For display update when power meter display is in hold mode), Manual print control
Control signal level	: From 0 / 5V logic signal or short//open contact signal
Other function	ons]
- Scaling	: PT/CT ratio Set range 0.0001 to 99999
Averaging	: Time average (set interval time, timer time, and average of realtime control time) Moving average (number of samples: 8/16/32/64) Exponential average (attenuation factor: 8/16/32/64)
Multilingual display	
Set time (all types)	: Interval control time (10 sec to 100 hours) in 10 sec increments (When used in combination with printer, auto select increments) Timer control time (1 min to 10000 hours) in 1 minute increments Realtime control time, 1 minute increments

[Harmonic / Flicker measurement] 9605 (optional) required Measurement item : See Page 4 specifications for 9605

Measurement accuracy (23°C±5°C (73°F±9°F), Less than 80% rh, warm up time greater than 1 hour, sine wave input, power factor = 1, in-phase voltage = 0) V. A. W : Per accuracy table on page 5 Motor output : ±1dgt for calculations of each measured value

v, A, vv		Ter accuracy table on page 5
Apparent / reactive	:	±1 dgt. with respect to calculation from measured value (U, I, P)
power		sum value is max. ±3dgt.
Integration	•	±ldgt with respect to values calculated from measurements (I, P)
Power factor	:	Max. ±3dgt with respect to values calculated from measurements (U, I, P)
Phase angle	:	Max. ±3dgt with respect to values calculated from measurements (U, I, P)
Frequency	:	$\pm 0.1\%$ rdg. ± 1 dgt. (0°C to 40°C(32°F to 104°F), for sine wave
		input between 10% to 130% of U/I range)
Wave peak	:	$\pm 1\%$ (at 0.5Hz to 1kHz), $\pm 2\%$ (at 1kHz to 10kHz), $\pm 10\%$
		(at 10kHz to 100kHz)

Motor output Efficiency	 ±1dgt for calculations of each measured value Max. ±7 dgt with respect to values calculated from measurements of items substituted into algorithm
Effect of in-phase voltage Effect of power factor Actual time D/A output Analog output	 Within ±0.03% f.s/ °C Within ±0.05% f.s (1000 Vrms, 50/6Hz, between shorted voltage input terminals and case) ±0.15% f.s (power factor = 0) ±25ppm ±1dgt. (0 to 40°C (73°F to 41°F)) Display accuracy - ±0.2% f.s Display accuracy - ±0.2% f.s Display accuracy - ±0.2% f.s (less than 100kHz) Display accuracy - ±3dB (100k to 1MHz)

General Specifications

	-
Location for use :	Indoors, altitude to 2000 m, Pollution level 2
Ambient use humidity :	Power meter, 0°Cto 40°C (32°F to 104°F), rh below 80% (no condensation)
Ambient use numberly	When using printer, 5°C to 40°C (41°F to 104°F), rh below 80%
Ambient storage humidity :	-10°C to 50°C (14°F to 122°F), rh below 80% and no condensation
Maximum rated voltage to earth :	Using with the 9600 and 9601
Ŭ	Voltage input terminal, Current input terminal
	600 V measurement category III (expected transient overvoltage: 6000 V)
	1000 V measurement category II (expected transient overvoltage: 6000 V)
	Using with the 9602
	Voltage input terminal
	600 V measurement category III (expected transient overvoltage: 6000 V)
Withstand voltage : (50/60 Hz, 1 minute)	AC5.55kV between U/I terminal and unit case, between U/I terminal and power supply plug (for 9600 and 9601), between U terminal and clamp input terminal, between U terminal and unit
	terminal and clamp input terminal, between O terminal and unit

case, between U input terminal and power supply plug (for 9602)

Certifications	: Safety EN61010 : EMC EN61326 EN61000-3-2 EN61000-3-3
Power supply Maximum rated power Dimensions, mass	: AC100V/120V/200V/230V (switched automatically), 50/60Hz
Accessories	(Not including projections such as terminals, feet, and handles)Power cord 1, ground adapter (3P to 2P) 1, connector 1

Current Sensors(Optional) Specifications

To use the Clamp-On sensor, be sure to order the factory option 9602 AC/DC Clamp Input Unit.

	AC/DC Current Sensors							AC Clamp- on Sensor	Conversion Adapter for AC only
	Feed-through current sensors				Clamp-on sensors				СТ
Model	CT6865 *	9709 *	CT6863 *	CT6862 *	9279	9278	9277	9272-10 *	9290-10
Physical appearance	P)	R	0	-	00		10 m	~	CT ratio 10:1 For 9272-10 only
Primary current rating	1000A	500A	200A	50A	500A	200A	20A	200A/20A	1500A
Measurable conductor diameter	ф36mm (1.42in)	ф36mm (1.42in)	φ24mm (0.94in)	ф24mm (0.94in)	φ40mm (1.57in)	ф20mm (0.79in)	ф20mm (0.79in)	ф46mm (1.81in)	φ55mm (2.17in)
Accuracy 45 to 66Hz 23°C±3°C (73°F±5.4°F)	±0.05%rdg. ±0.01%f.s. (vibration amplitude) ±0.2° max.(phase, DC not specificied)	Warming up for at least 10 minutes: ±0.05%rdg. ±0.01%f.s. (vibration amplitude) ±0.2°max.(phase, DC not specificied)	±0.05%rdg.		After degaussing and warming up for at least 30 minutes: ±0.5%rdg. ±0.05%f.s. (vibration amplitude) ±0.2°max. (phase, DC not specificied)			±0.01%f.s.	±1.5%rdg. (vibration amplitude ±0.2°max. (phase)
Frequency characteristics (vibration amplitude, phase) (deviation from the basic accuracy)	DC to 16Hz : ±0.1%max. To 5kHz : ±5.0%max. To 20kHz : ±30%max	DC to 45Hz : ±0.2%max. To 10kHz : ±2.0%max. To 100kHz : ±30%max.	: ±0.1%max. To 100kHz	To 100kHz	DC to 1kHz : ±1.0%max. To 10kHz : ±2.5%max. To 20kHz : ±5.0%max.	: ±1.0%max. := To 50kHz To 100 : ±2.5%max. := To 100kHz To 100		1Hz to 5kHz : ±2.0%max. To 10kHz : ±2.5%max. To 100kHz : ±30%max.	20Hz to 5kHz : ±2.0%max
others	Set CT ratio : 2								80mm(3.15 in) ×20mm(0.79in) busba

*For further details, please refer to the individual product catalog for the instrument.

Ordering information

POWER HITESTER 3193-10 (main unit only)

The POWER HITESTER 3193-10 cannot operate alone. A factory option input unit must be purchased.

(): 9600, 9601, 9602 can be selected.								
	1ch	2ch	3ch	4ch	5ch	6ch		
Pattern A	1 ø 2W ()	$1 \neq 2W($)	1 ø 2W ()	1 ø 2W ()	1ø2W()	1 ø 2W ()		
Pattern B	1 ø 3W / 3 ø 3	W (×2)	1ø2W()	1 ø 2W ()	1ø2W()	1 ø 2W ()		
Pattern C	1 ø 3W / 3 ø 3	W (×2)	1 ø 3W / 3 ø 3	W (×2)	1ø2W()	1 ø 2W ()		
Pattern D	1 ø 3W / 3 ø 3	W (×2)	1 ø 3W / 3 ø 3	W (×2)	1 ø 3W / 3 ø 3	W (×2)		
Pattern E	3V3A (3 ø	3W) / 3 ø 4W	(×3)	1 ø 2W ()	1ø2W()	1 ø 2W ()		
Pattern F	3V3A (3 ø	3W) / 3 ø 4W	(×3)	1 ø 3W / 3 ø 3	W (×2)	1 ø 2W ()		
Pattern G	3V3A (3 ø	3W) / 3 ø 4W	(×3)	3V3A (3 ø 3	3W) / 3 ø 4W	(×3)		

+86-21-63910090 FAX +86-21-63910360 http://www.hioki.cn / E-mail: info@hioki.com.cn

HIOKI INDIA PRIVATE LIMITED: TEL +91-124-6590210 FAX +91-124-6460113 E-mail: hioki@hioki.in

TEL +65-6634-7677 FAX +65-6634-7477 E-mail: info-sg@hioki.com.sg

Options that can be installed at the factory

(specify at time of order) AC/DC DIRECT INPUT UNIT 9600 AC DIRECT INPUT UNIT 9601 AC/DC CLAMP INPUT UNIT 9602 **EXTERNAL SIGNAL INPUT UNIT 9603** PRINTER UNIT 9604 * Not CE marked HARMONIC / FLICKER MEASUREMENTS UNIT 9605 * Not CE marked

*Voltage cables are not supplied. Also, please contact your HIOKI distributor for clip type leads or other special needs.

Options

AC/DC CURRENT SENSOR CT6865 (1000A AC/DC) AC/DC CURRENT SENSOR 9709 (500A AC/DC) AC/DC CURRENT SENSOR CT6863 (200A AC/DC) AC/DC CURRENT SENSOR CT6862 (50A AC/DC) UNIVERSAL CLAMP ON CT 9279 (500A AC/DC) * Not CE marked UNIVERSAL CLAMP ON CT 9278 (200A AC/DC) UNIVERSAL CLAMP ON CT 9277 (20A AC/DC) CLAMP ON SENSOR 9272-10 (20/200A AC) CLAMP ON ADAPTER 9290-10 (1500A AC, ratio10:1) VOLTAGE CORD L9438-50 (1 each red and black, approx 3m) RECORDING PAPER 9232 (10 m, 10 roll, For 9604)

Note: Company names and Product names appearing in this catalog are trademarks or registered trademarks of various companies. HIOKI (Shanghai) SALES & TRADING CO., LTD.:

HIOKI E.E. CORPORATION

HEADQUARTERS:

81 Koizumi, Ueda, Nagano, 386-1192, Japan TEL +81-268-28-0562 FAX +81-268-28-0568 HIOKI SINGAPORE PTE. LTD.: http://www.hioki.com / E-mail: os-com@hioki.co.jp TEL +65-6634-7677 FAX +65-66

HIOKI USA CORPORATION: TEL +1-609-409-9109 FAX +1-609-409-9108 http://www.hiokiusa.com / E-mail: hioki@hiokiusa.com

All information correct as of June 30, 2014. All specifications are subject to change without notice.

DISTRIBUTED BY

(주)누비콤 서울특별시 서울특별시 영등포구 경인로 775(문래동 37; 에이스하이테크시티 3동 201호) TEL: 070-7872-0701 FAX: 02-2167-3801 E-mail: sales@nubicom.co.kr

고객지원센터 TEL: 070-7872-0701, 080-801-7880 FAX: 02-2167-3802 E-mail: oft@nubicom.co.kr

대전 사무소 내건 사구조 대전광역시 유성구 대덕대로 593(도룡동 386-2) 대덕테크비즈센터 203호 TEL: 070-7872-0712 FAX: 042-863-2023 E-mail: inyeom@nubicom.co.kr

Notes on input unit selection

- Use the same input unit for a particular measurement line.
- Install units in succession starting from channel 1.
- For the 9603 only one unit can be installed.

• When the 9602 is selected, use an optional clamp-on sensor.

319310E6-46E Printed in Japan